


# Chain Drives

## Low-speed bush chains

MoraviaŘetězy



### Low-speed bush chains - TM70 - TM100

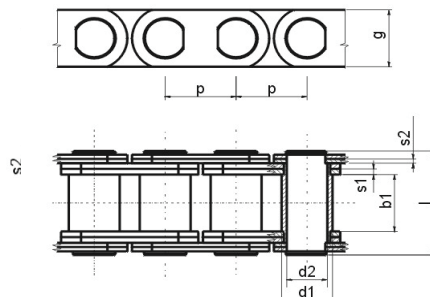

Chain number	Pitch P	b <sub>1</sub> min mm	b <sub>2</sub> max mm	d <sub>1</sub> max H 11	d <sub>2</sub> max mm	g max mm	s <sub>1</sub> max mm	s <sub>2</sub> max mm	l max mm	Chain joint area			Mass q kg/m
										k max mm	f cm <sup>2</sup>	F <sub>B</sub> min N	
TM 70	70	60	87	40	32	64,00	6	4,5	7,9	125	27,2	250 000	27,20
TM 80	80	70	102	44	34	74,00	5	4,5	7,9	145	36,0	315 000	36,40
TM 90	90	80	113	48	36	84,00	5	4,5	7,9	158	40,0	400 000	44,20
TM 100	100	90	122	52	38	94,00	5	4,5	10,5	167	45,8	500 000	50,50

All dimension in mm unless otherwise stated.

Every effort has been taken to ensure that the data listed in this catalogue is correct. MORAVIA RETEZY accepts no liability for any inaccuracies or damage caused.